

Non-Compliance Notice - Issued

Permit Holder: Tourmaline Oil Corp.
Discovery Date: 2026-10-15
As a result of Inspection 2026-3544

An Inspection was conducted and as a result the following Non-Compliances were found. These Non-Compliances must be corrected by the required Correction Due Dates as indicated below. Consideration should be given to checking your other locations for similar Non-Compliances. To respond to these Non-Compliances, access the CM-IS Permit Holder Application.

Non-Compliance Number: 2026-0681-01 Issued Date: '2026-10-26' Status: Issued Outcome: Correction Duration: 30 Days Correction Due Date: '2026-11-25'	Permit: 100105156 Well ID: 36472 Well Name: TOURMALINE HZ GUNDY CREEK B-Q035-A/094-B-16 Location: NTS: B-Q035-A/094-B-16 Legislation: Drilling and Production Regulation 78 (1.1) A facility permit holder must ensure that all tools and equipment used in facility operations are installed and operated in accordance with the manufacturer's specifications or sound engineering practices.
Non-Compliance Comment: The main cap on the catadyne electrical junction box below the heater is very loose and not electrically sound. Also, with the cap so loose the connection may not be packed and poured as required. This appears on quite a few catadyne connection boxes so check all of your well suitcases.	

Non-Compliance Number: 2026-0681-02 Issued Date: '2026-10-26' Status: Issued Outcome:	Permit: 100105156 Well ID: 36471 Well Name: TOURMALINE HZ GUNDY CREEK B-P035-A/094-B-16 Location: NTS: B-P035-A/094-B-16 Legislation: Drilling and Production Regulation 49 (2) Subject to subsection (1), a permit holder must lock or car seal any valve or device that can bypass or disable safety equipment at a well that is producing, injecting or disposing of fluids, or at a facility.
--	--

Correction Duration: 14 Days Correction Due Date: '2026-11-09'	
Non-Compliance Comment: The cable car seal on the isolation ball valve for the hi/lo pilot is far too loose to the point where it does not prevent the handle from being moved in either the closed or open position. The cable needs to be tightened. This loose cable issue is not restricted to this particular well and all of well facility skids need to be checked	
Non-Compliance Number: 2026-0681-03 Issued Date: '2026-10-26' Status: Issued Outcome: Correction Duration: 30 Days Correction Due Date: '2026-11-25'	Permit: 100105156 Facility ID: 00026706 Facility Name: TOURMALINE GUNDY CREEK B-035-A/094-B-16 001 Facility Type: Well Facility Location: NTS: B- 035-A/094-B-16 Legislation: Energy Resource Activities Act 37 (2) If spillage occurs, a permit holder or person carrying out an energy resource activity must promptly do all of the following: (a) remedy the cause or source of the spillage;
Non-Compliance Comment: The test separator for the first 2 bank of wells-the condi "Y" strainer is weeping produced water as evidence of a crystal build up.	

Authorized by BCER